
SHORT-CIRCUITING (EARTHING) EQUIPMENT VHV 420 kV

for \varnothing conductors 70 - 100 mm

Models 815.420 - 10 (15)

General Information

The short-circuiting (earthing) equipment is designed for short-circuit making and earthing of the circuit in networks with an earthed node of the nominal voltage of up to 400 kV. The short-circuiting set consists of **one insulating pole**, one supporting pole and three short-circuiting cables ended with conductor and universal earthing clamps to connect it to the conductor of circular cross section up to 100 mm in diameter. Conductor clamps are connected to earthing clamps by Cu cables in transparent isolation. Insulating pole is made of glass-fabric laminate which is suitable for its high electrical and mechanical resistance and stability. Upper part is ended with socket for conductor clamp handling. Pole consists of three pieces connected by means of connecting element It fulfills the requirements on the protection equipment for outdoor use. The set is determined for outdoor use under normal climatic conditions. The handle is provided with the protecting ring (hand guard). Short-circuiting set complies with standards ČSN EN 61230 ed.2, IEC 61230, DIN 46235. It is produced in two models for various shorttime withstanding current. It is possible to modify the model at the custom's request.

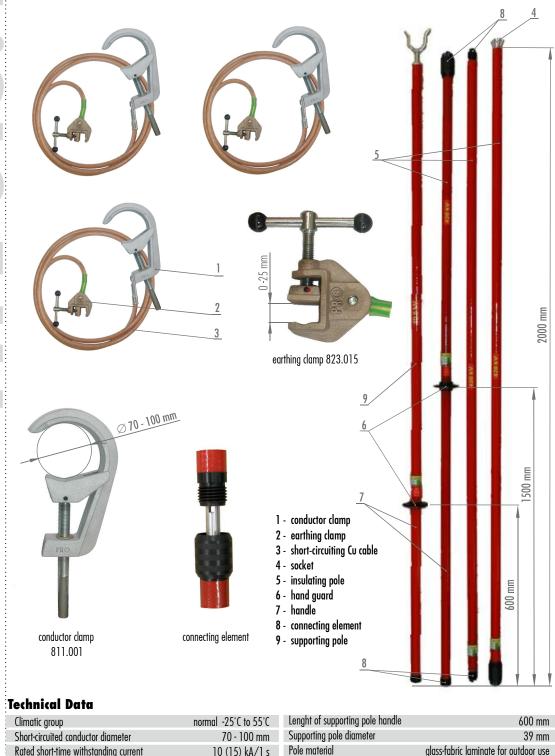

Climatic group normal -25 C to 55 C Length of supporting pole flainate Short-circuited conductor diameter 70 - 100 mm Supporting pole diameter Rated short-time withstanding current 10 (15) kA/1 s Pole material glass-fabric Lenght of pole 6000 mm Cross section of cable Lenght of handle 1500 mm Lenght of cable Pole diameter 47 mm Tightening of clamps Lenght of supporting pole 2000 mm Weight of equipment

PRO 8 s.r.o., Semtín 96 530 O2 Pardubice, Czech Republic tel. +420 466 824 930

e-mail: pro8@pro8.cz www.pro8.cz La

Changes excepted! Last revision January 2017



50 (70) mm²

9000 mm


25 (30) kg

12 Nm

SHORT-CIRCUITING (EARTHING) EQUIPMENT VHV 420 KV

for \varnothing conductors 70 - 100 mm





Directions for use

Before using the set, it is necessary to use a voltage detector to be sure that the traction is without tension.

The short-circuiting equipment is fixed in this way:

1) connect all insulating poles by means of connecting element before using, to check of stability of tightening and to performe the visual check of their status

2) fix the earthing clamp to the earthing conductor or to the metallic grounded construction

3) push this clamp into the socket on the insulating pole to fix the conductor clamp properly

4) rotate the insulating pole (while holding the clamp) until the clamp jaws open according to the diameter of the short-circuited conductor5) put the conductor clamp on the short-circuiting phase conductor of circular cross section

6) rotate reverse by the insulating pole to constriction of the clamp

- 7) pull the pole backward from the conductor clamp to release the pole
- 8) fix other two clamps in the same way including the the earthing clamps
- 9) when removing the clamp, proceed reversely

Make sure the clamp is tightened properly. The tightening torque must not exceed 12 Nm.

<u>Warning!</u> The supporting pole shall be used during lifting insulating poles in relation to total weight of the pole, clamp and short-curcuiting cable. The upper end of insulating pole shall be supported by supporting pole and the insulating pole is gradually lifted to a vertical position. This handling requires <u>two persons</u>.

<u>The short-circuiting set should only be used on electrical</u> <u>facilities with nominal voltage for which it is designed.</u> <u>The instructions for use should be incorporated into the local operating and safety</u> <u>regulations.</u>

The set may only be used by qualified personnel.

Instructions for current maintenance

The set must be kept in good technical condition. Make sure that the set is stored in the way to keep it dry and to prevent any mechanical damage. Perform a visual check before each use. At least once a year, it is necessary to perform a thorough check of the whole set, including cleaning and tightening all the connecting points.

For common cleaning of teh poles use damp cloth, for more resistance dirt use technical alcohol. Do not use any organic solvents or any substances which may have a decolorizing effect.

<u>III The set must be eliminated or proved again its right funkcionality, when a short-circuiting current has already gone through short-circuiting current III</u>

ຼຸ ? Testing

The set is type-tested according to valid standards by the authorised labratory. Each set is separately tested piece by piece before expedition and labeled too. The label includes the test date (quarter/year) and the number of the authorised laboratory.

Packing

0.

The cables with clamps are supplied in a water-resistant carry bag. The insulating poles are wrapped in a transparent plastic foil. There is enclosed the function description and the directions for use, the Certificate about quality and completeness of product and product test.

Guarantee

The guarantee period is 24 months long and starts on the day the product is delivered to the customer. It applies to any defects probably caused by the manufacture. The guarantee does not cover any defects resulting from improper use, unprofessional handling, or unsuitable storing.

